

Levaset Yellow 4GN

Short Profile

- Brilliant lemon yellow for making good green shades using Levaset Blue 5G and Levaset Blue 2R

Substrate Suitability :

Polyamide	S
Wool	S
Silk	S


General properties:

Solubility at 90°C	80
Dischargeability (Zn Sulfoxylate Formaldehyde)	1-2


Shade change under article light:

D65	Inc A	F11 (TL 84)
Control	Greener/M. Bluer	M. Greener/Yellower


Cross staining on other components of blends in one bath dyeing :

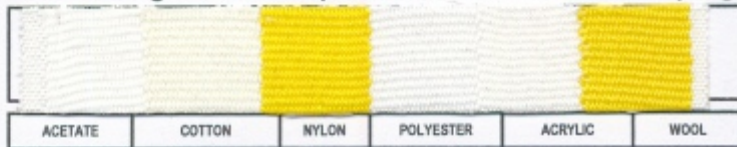


Exhaustion Fixation: (1/1 S/D)

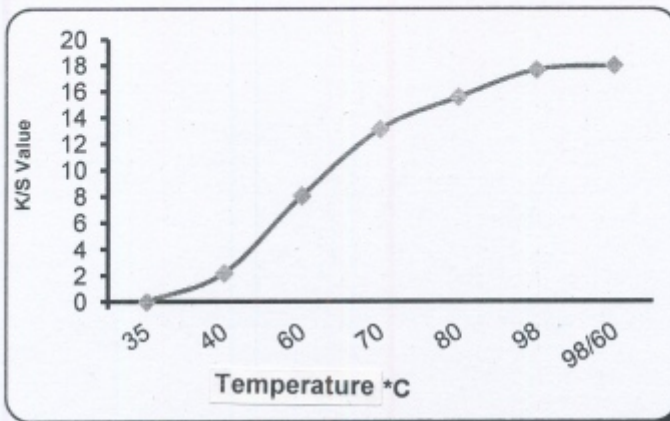

Saturation Curve:

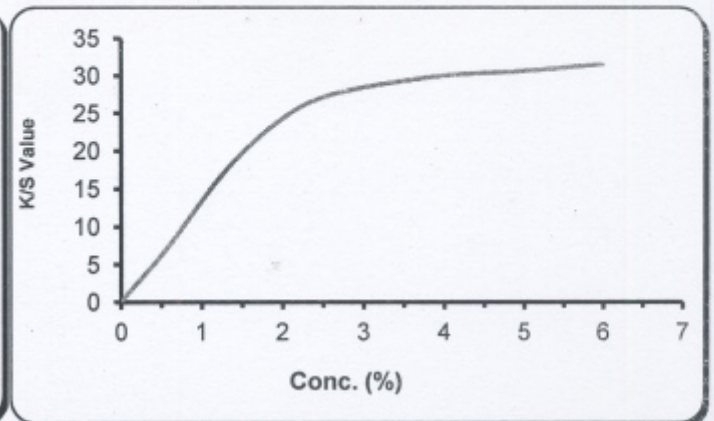

0.10% (1/12 SD)

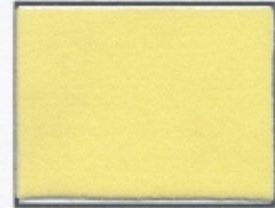

0.43% (1/3 SD)



1.30% (1/1 SD)



(Exhaust Dyeing on PA fabric at 98°C for 45 min pH 4-5 with Buffer System)

(This information is provided in good faith, to the best of our knowledge and without liability)

Fastness Properties Details

After Treatment	PA 6			PA 6,6				
Light Fastness Shade depth	1/12	1/3	1/1	1/12	1/3	1/1		
Light fastness (ISO 105 B02)- Upto grade 6	5	6	6+	5	5	6		
Light fastness (AATCC 16E) 20 AFU	4-5	5	5	5	4-5	5		
Light fastness (AATCC 16E) 40 AFU	4	4-5	5	5	4	4-5		
After Treatment	Without				With 2% Levacol NR			
Wet Fastness properties on 1/1 SD	SC	WO	PA	CO	SC	WO	PA	CO
Wash fastness (ISO 105 C10 - B (50°C))	4-5	4-5	4-5	4-5	4-5	4-5	4-5	4-5
Wash fastness (ISO 105 C10 - C (60°C))	4	4-5	4-5	4-5	4	4-5	4-5	4-5
Wash fastness ((AATCC 61 Option 2A,49°C,))	4	4	4-5	4	4	4	4	4-5
Water Sever (ISO 105 E01)	4	4-5	4-5	4-5	4	4-5	4-5	4-5
Fastness to Sea Water (ISO 105 E02)	4	4-5	4-5	4-5	4	4-5	4-5	4-5
Perspiration fastness (ISO 105 E04)	Acid	4-5	4-5	4-5	4-5	4-5	4-5	4-5
	Alkaline	4-5	4-5	4-5	4-5	4-5	4-5	4-5
Fastness to Dry Cleaning (ISO 105 D01-1993)	4	4-5	4-5	4-5	4	4-5	4-5	4-5

Crocking Fastness (ISO 105 X12)	Dry	5	Wet	4-5
Fastness to Chlorinated water (ISO 105 E03)	20ppm	3-4	50ppm	2-3

Stripping with recommended Recipe :

Heat up to 98°C & hold for 60 min, then rinse neutralisation with Acetic acid (pH 5.5) at Room Temp. followed by warm and cold wash.

Original Fabric	3 gpl Levacol CBSE 3 % Soda Ash	5 gpl Levacol ECO 4 pH Acetic Acid

(Levocol NR – 2.0% w.o.f + acetic acid – 4 pH at 70°C/20 min.)

Remarks:-

Abbreviation: S-Suitable, R - Not Recommended,

(CS = Change of Shade , SW = Staining on Wool , SP = Staining on Polyamide , SC = Staining on Cotton)

(This information is provided in good faith, to the best of our knowledge and without liability)